

April 18, 2018

SJP-26

RUNNING INHIBITORS THROUGH LINES

PURPOSE/APPLICATION

PPE

- Face shield/Safety Glasses •
- Rain Suit •
- Rubber Gloves .
- Hard Hat •

•

- Safety Glasses •
- FRC Coveralls •
- Personal Monitors •

TRAINING

WHMIS/First Aid/H2S/CSTS/TDG

TOOLS/EQUIPMENT

Air Compressor/Pigs/Wrenches/Radios •

#	Job Steps		Hazards		Control Measures
	Go over Material Safety Data Sheet/ Tailgate/ Safe Work Procedure and Hazard Assessments.	Incorrect orInadequate Information	Incorrect or Inadequate Information.		Ensure all involved have access to information documentation.
				•	All appropriate information and hazards will be listed on all permits prior to starting work.
2	Wear proper PPE	ear proper PPE Inhibitor/Gas from pipeline. 	•	PPE must be worn at all times.	
			pipeline.	•	MSDS know which inhibitor you are running.
3	Prove line is de-pressured.	•	Line is still energized.	•	Open pig trap/Open vents and drains.
				•	Inspect equipment.



April 18, 2018

RUNNING INHIBITORS THROUGH LINES

SJP-26

#	Job Steps	Hazards	Control Measures		
4	Open closure, insert medium	 Pinch points. 	Wear all PPE.		
	density pig, close closure	 Line pressurized. 	 Eyes and mind on task. 		
		 Sludge in line from 	 Open vents and drains. 		
		before.Flammable gases.	 Inspect the pig senders and catchers before each use, and ensure they are in good working condition. 		
			 Stay clear of closure when opening. (stand to the side) 		
			 Always contain and control all releases of pressure and product. 		
			 Ensure pig is in pipeline correctly. 		
			• Use drip trays as needed.		
			Continuous monitor.		
5	Hook up compressor and shoot pig approximately for 30 seconds depending on how much fluid you need for line.	Compressed air.	Wear all PPE.		
		Equipment failure.Pig stuck.	 Ensure all connections are secure. (Whip Checks/Cotter pins) 		
			• Ensure the proper pressure rating on equipment.		
			Inspect hoses and couplers.		
			 Use proper pig senders and catchers. 		
			 Ensure all equipment being used is appropriate for the task and was designed for the intended use. 		
6	Close valve on riser		 Eyes and mind on task. 		
7	Insert diesel inhibitor through 2" valve between top 45 degree and valve on pig catcher	Line pressurized.	Open vents/drains		
		 Spill diesel/inhibitor. 	 Drip tray available. 		
			 Ensure you have a large enough funnel to pump diesel/inhibitor. 		



April 18, 2018

RUNNING INHIBITORS THROUGH LINES

#	Job Steps	На	Hazards		Control Measures		
8	Open closure and put inhibitor pig in. close closure	•	Pinch points	•	Eyes and mind on the task.		
		-	Line pressurized.	-	Open vents/drains.		
		•	Flammable Gases.	•	Ensure pig is in pipeline correctly.		
				•	Continuous Monitor.		
9	Have vacuum truck and some sort of communication on the other end of the line. (2-way radio is preferred method)	•		•	Test radios and keep them charged. If malfunctioning, then replace.		
				-	Speak clearly and double check if unsure.		
				•	Ensure hoses and equipment are in good working condition.		
				•	Inspect equipment before use.		
10	Once both parties give the go ahead, compressor can start blowing pigs and inhibitor down the line.	•	Compressed Air.	•	Wear all PPE.		
		Equipment failure.	-	Ensure all connections are			
		-	Communication.		secure and of the proper pressure rating.		
		•	Ice plugs in existing pipeline.	•	Inspect hoses/couplers and use whip checks/cotter pins to secure hoses in case of failure.		
				•	Only required and qualified personal in the work area.		
				•	Ensure all equipment being used is appropriate for the task and was designed for the intended use.		
				•	Make sure lines of communication are open at all times during the inhibitor run.		
				•	May be necessary to run a methanol batch in front of first pig if you think you may encounter an ice plug.		

SJP-26



April 18, 2018

RUNNING INHIBITORS THROUGH LINES

SJP-26

#	Job Steps	Hazards		Control Measures	
#	Job Steps Once pigs reach other end, let the crew running the compressor know to shut compressor down, and start blowing down the line, through the vac-truck	Hazards Lack of Communication. Line under pressure. Equipment Failure. Pig Stuck.	•	Ensure good radio contact and keep all lines of communication open during bleed down. Eyes and Mind on task. Make sure to bleed from pig catcher side so pigs don't get sucked back. Proper PPE at all times. Ensure all connections are secure and of the proper pressure rating. Only required and qualified personal in the work area. Ensure vents are open on Vac truck when blowing down. Ensure all equipment being used is appropriate for the task and was designed for the intended use. Inspect hoses/couplers and use whip checks/cotter pins to secure hoses in case of failure.	
			•		



April 18, 2018

RUNNING INHIBITORS THROUGH LINES

SJP-26

#	Job Steps	Hazards	Control Measures
12	Once pressure is out of line, open receiving closure cautiously and have a drip tray underneath of closure in case of excess fluid. Have vacuum truck suck up any fluid left-over.	 Flammable Gases Spills Pinch Points Line under pressure 	 Continuous Monitor Drip trays as needed. Always dispose of wastes in a timely manner and in an appropriate manner. Wear all appropriate PPE. Always control and contain all releases of pressure and product Eyes and mind on task. Keep vents/drains open.

Additional Precautions: Please ensure that all MSDS are onsite and reviewed prior to job commencement. Follow PPE requirements as per MSDS.

REFERENCE/REGULATIONS

- Part 2 Hazard Assessment, Elimination and Control
- Part 29 WHIMIS.
- Part 18 PPE.
- Part 11 First Aid.
- Part 4 Chemical Hazards, Biological Hazards and Harmful Substances.

Developed by:	1.	Shaun Hebert	2.	Date:	Jan 28/10
Revised by:	1.	Ryan Obleman	2.	Date:	Apr 18/18